

Panasonic®

取扱説明書  
Operating Instructions  
ワイヤ送給装置  
Wire feeder

品番/Model No.

YW-60KC2K series

品番 /Model No.

YW-60KC2KFN  
YW-60KC2KFR



このたびは、パナソニック製品をお買い上げいただき、まことにありがとうございます。

- 取扱説明書をよくお読みのうえ、正しく安全にお使いください。  
周辺機器の取扱説明書も、あわせてお読みください。  
ご使用前に「安全上の注意」を必ずお読みください。  
この取扱説明書は大切に保管してください。
- Before operating this product, please read the instructions carefully and save this manual for future use.  
Please also read the operating instructions of peripheral equipment.  
First, please read the "Safety Precautions".

OMWT0304JE05

English version is the original instructions.

## ◆もくじ

はじめに .....	4
1. 安全上のご注意（必ずお守りください）	5
2. 接続方法 .....	6
2.1 溶接電源およびガス調整器との接続.....	6
2.2 溶接トーチの接続 .....	6
3. 使用準備 .....	7
3.1 設置・使用場所 .....	7
3.2 溶接ワイヤの取付方法 .....	8
4. 保守・点検.....	9

## ◆Table of Contents

Introduction .....	10
1. Safety precautions .....	11
2. Connection .....	12
2.1 Connecting Power source and Gas regulator .....	12
2.2 Connecting Welding torch .....	12
3. Preparation .....	13
3.1 Work environment .....	13
3.2 Mounting Weld wire .....	14
4. Maintenance .....	15

## ◆ 技術データ / Technical data

### 5. 共通技術データ /Common technical data.....16

5.1 仕様 / Specifications .....	16
5.2 付属品 Accessories .....	16
5.3 外形図 / Dimensions .....	17
5.4 回路図 / Circuit diagram.....	17
5.5 パーツリスト / Parts list .....	18

### 6. 特殊仕様技術データ /Customized technical data.....20

6.1 YW-60KC2KFN .....	20
6.1.1 特殊仕様内容 / Customized specifications	20
6.1.2 パーツリスト / Parts list .....	20
6.2 YW-60KC2KFR .....	20
6.2.1 特殊仕様内容 / Customized specifications	20
6.2.2 パーツリスト / Parts list .....	20

# はじめに

## ◆ はじめに

本製品は、パナソニック溶接電源に使用される小形軽量に製作されたワイヤ送給装置です。本書はパナソニック溶接ワイヤ送給装置 YW-60KC2 から適用ワイヤ径の仕様を変更した製品の取扱説明書です。ご使用製品の品番の箇所も忘れずにお読みください。

## ◆ 安全について

本製品の設置、使用、サービスに先立ち、接続されている溶接電源およびその他関連する機器の取扱説明書に記載されている安全事項をご理解ねがいます。

## ◆ 安全な使い方に関する警告表示

人への危害、財産の損害を防止するため、必ずお守りいただくことを説明しています。

● 人への危害、財産の損害を防止するため、必ずお守りいただくことを説明しています。	● お守りいただく内容を次の図記号で説明しています。
 <b>危険</b> 「死亡や重傷を負うおそれがある内容」です。	 してはいけない内容です。
 <b>警告</b> 「死亡や重傷を負うおそれがある内容」です。	 実行しなければならない内容です。
 <b>注意</b> 「傷害を負うことや、財産の損害が発生するおそれがある内容」です。	  気をつけていただく内容です。

## ◆ 本製品を日本国外に設置、移転する場合のご注意

- ・本製品は、日本国内の法令および基準に基づいて設計、製作されています。
- ・本製品を日本国外に設置、移転する場合、そのままでは設置および移転する国の法令、基準に適合しない場合がありますのでご注意ください。
- ・本製品を日本国外に移転・転売をされます場合は、必ず事前にご相談ください。

### 【本製品廃棄上のご注意】

本製品を廃棄される場合は、認可を受けた産業廃棄物処理業者と廃棄処理委託契約を締結し、廃棄処理を委託してください。

- ・本書の記載内容は、2022年1月現在のものです。
- ・本書の記載内容は、改良のため予告なしに変更することがあります。

# 1. 安全上のご注意（必ずお守りください）



## 警 告

重大な人身事故を避けるために、必ず次のことをお守りください。

- (1) このワイヤ送給装置を溶接以外の用途に使用しない。
- (2) ワイヤ送給装置の使用にあたっては注意事項を必ず守る。
- (3) 入力側の動力源の工事、設置場所の選定、高圧ガスの取り扱い・保管および配管、溶接後の製造物の保管および廃棄物の処理などは、法規および貴社社内基準に従う。
- (4) 溶接機や溶接作業場所の周囲に不用意に人が立ち入らないよう保護する。
- (5) 心臓のペースメーカーを使用している人は、医師の許可がるまで操作中の溶接機や溶接作業場所に近づかない。
- (6) ワイヤ送給装置の据え付け、保守点検、修理は、有資格者または溶接機をよく理解した人が行う。
- (7) ワイヤ送給装置の操作は、取扱説明書をよく理解し、安全な取り扱いができる知識と技能のある人が行う。  
(労働安全衛生規則を参照)

### 排気設備や保護具



狭い場所での溶接作業は、酸素の欠乏により、窒息する危険性があります。  
溶接で発生するガスやヒュームを吸引すると、健康を害する原因になります。

- (1) 法規（労働安全衛生規則、酸素欠乏症等防止規則）で定められた場所では、十分な換気をするか、空気呼吸器等を使用する。
- (2) 法規（労働安全衛生規則、粉じん障害防止規則）で定められた局所排気設備を使用するか、呼吸用保護具を使用する。  
呼吸用保護具は、より防護性能の高い電動ファン付き呼吸用保護具を推奨します（第8次粉じん障害防止総合対策）。

- (3) タンク、ボイラー、船倉などの底部で溶接作業を行う時、炭酸ガスやアルゴンガス等の空気より重いガスは底部に滞留する。酸素欠乏症を防止するため、十分な換気をするか、空気呼吸器等を使用する。
- (4) 狹い場所での溶接では、必ず十分な換気をするか、空気呼吸器を使用し、訓練された監視員の監視のもとで作業をする。
- (5) 脱脂、洗浄、噴霧作業などの近くでは、溶接作業を行わない。有害なガスを発生することがある。
- (6) 被覆鋼板を溶接すると、有害なガスやヒュームが発生する。必ず十分な換気をするか、呼吸用保護具を使用する。

### 火災や爆発、破裂



火災や爆発、破裂を防ぐために、必ず次のことをお守りください。

- (1) 飛散するスパッタが可燃物に当たらないよう、可燃物を取り除くか、不燃性カバーで可燃物を覆う。
- (2) 可燃性ガスの近くでは、溶接しない。  
可燃性ガスの近くに溶接機を設置しない（溶接機は電気機器であり、内部の電気火花により引火する可能性がある）。
- (3) 溶接直後の熱い母材を、可燃物に近づけない。
- (4) 天井、床、壁などの溶接では、隠れた側にある可燃物を取り除く。
- (5) ケーブル接続部は、確実に締めつけて絶縁する。
- (6) 母材側ケーブルは、できるだけ溶接する個所の近くに接続する。
- (7) 内部にガスが入ったガス管や、密閉されたタンクやパイプを溶接しない。
- (8) 溶接作業場の近くに消火器を配し、万一の場合に備える。



## 注 意

### 保護具



溶接で発生するアーク光、飛散するスパッタやスラグ、騒音は、目の炎症や皮膚のやけど、聴覚に異常の原因になります。

- (1) 溶接作業や溶接の監視を行う場合には、十分なしゃ光度を有するしゃ光保護めがね、または溶接用保護面を使用する。
- (2) スパッタやスラグから目を保護するため、保護めがねを使用する。
- (3) 溶接作業場所の周囲に保護幕を設置し、アーク光が他の人々の目に入らないよう遮へいする。
- (4) 溶接用皮製保護手袋、長袖の服、脚カバー、皮前かけなどの保護具を使用する。
- (5) 騒音レベルが高い場合には、防音保護具（耳栓、イヤーマフなどの耳覆い）の種類は、法規にしたがって使用する。

### 回転部



回転部は、けがの原因になります。

- (1) ワイヤ送給装置のケースやカバーは必ず取り付けて使用する。
- (2) 保守点検、修理などでケースやカバーを外す時は、有資格者または溶接機をよく理解した人が行い、溶接機の周囲に囲いをするなど、不用意に人が近づかないようにする。
- (3) 回転中の冷却扇や送給ロールに、手、指、髪の毛、衣類などを近づけない。

## 2. 接続方法




### 注意

必ず配電ボックスおよび溶接機の電源を切ってから接続作業をしてください。

### 2.1 溶接電源およびガス調整器との接続


ワイヤ送給装置制御ケーブルは溶接電源の前面下部の「ワイヤ送給装置」コンセントに、パワーケーブルは「+」端子に接続します。ガスホースは別売のガス調整器に接続します。

No.	名称	接続方法
①	制御ケーブル	キー溝付ネジ込み接続
②	パワーケーブル	電源付属のボルトナットで接続
③	ガスホース	挿入後付属のホースバンドで固定

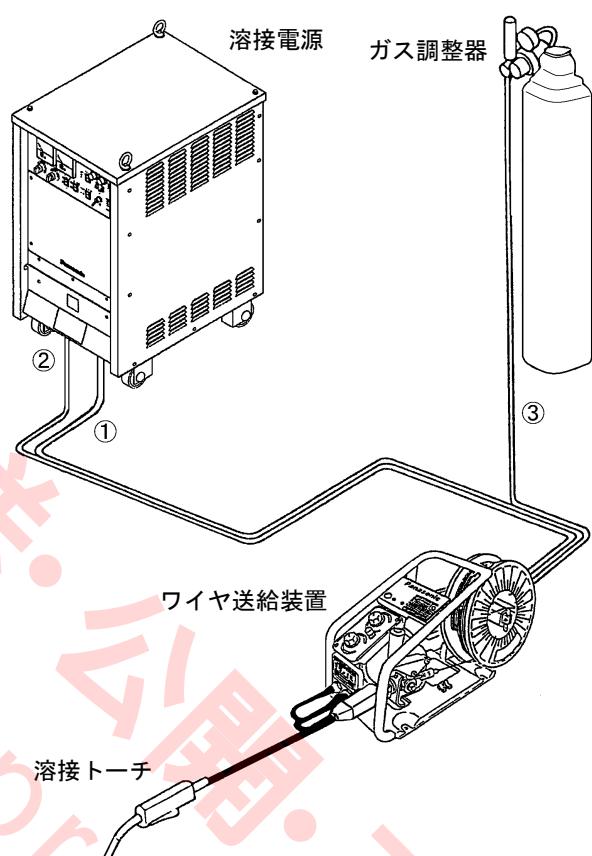

### 2.2 溶接トーチの接続

- (1) 溶接トーチの接続金具平坦部を C C 取付金具の締め付ボルト側にして、C C 取付金具に挿入します。
- (2) 最後まで挿入した後、左右いずれかへ 90° ほど回して、締付ボルトを十分に締め付けます。
- (3) 溶接トーチのトーチスイッチをトーチスイッチコンセントに、ガスホースをガスバルブの出口側金具に接続します。

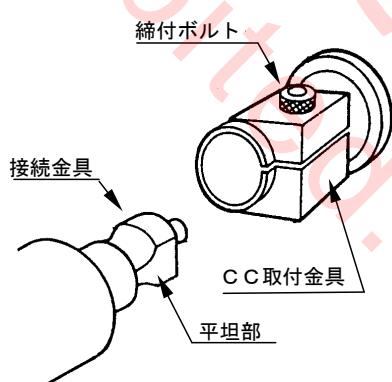

### 3. 使用準備



#### 注意

- ・送給ロールやワイヤスプールなどの回転部に、手、指、髪の毛、衣類などを近づけると、巻き込まれてけがをすることがあります。
- ・作業前にキャプタイヤケーブルの接続端子が確実に締め付けられていることを確認してください。 不完全な接続は不安定な溶接アークや端子部焼損の原因になります。


#### 3.1 設置・使用場所

ワイヤ送給装置は下記の条件を満たす場所でご使用ください。

- ・屋内仕様です。水滴や雨のかからない場所
- ・周囲温度は $-10^{\circ}\text{C}$ から $40^{\circ}\text{C}$ の環境
- ・極端な振動。衝撃のない場所への設置

#### 注記

- ・ワイヤ送給装置を吊下げる場合耐荷重の十分な枠本体ベース（下図参照）をご用意ください。4カ所の取り付け穴に吊下げ金具を取り付け、取付ボルトが緩まないように十分締めます
- ・スプール軸の抜け止め座がほぼ沿直になるように、スプール軸を組み替えてください。

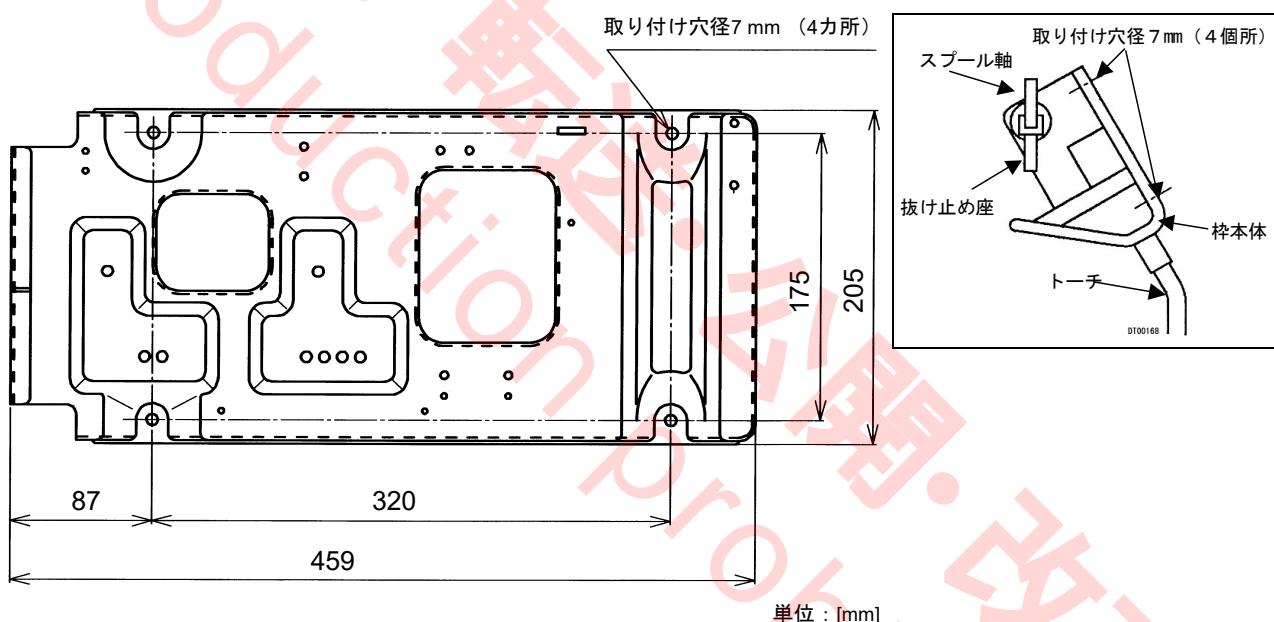

### 3.2 溶接ワイヤの取付方法

#### ● フィードローラの取付

フィードローラにミゾを2本設けています。使用するワイヤ径の刻印が外側になるように取付けてください。

#### ● ワイヤの装着

- (1) スプール金具のスプール抜止座を倒す。
- (2) ワイヤスプールを取付ける。
- (3) スプール抜止座を元にもどす。
- (4) 加圧ナットを外し、加圧アームを持ち上げる。
- (5) ワイヤ矯正ローラの間にワイヤを通した後、Sチューブの中に2~3cm入れる。
- (6) 矯正調整ボルトでワイヤ矯正を調整する。
- (7) 加圧アームを元にもどし、加圧ナットで締め付ける。


#### 注記

ワイヤ加圧は加圧ナット底面が使用するワイヤ径表示上に来る程度に調整します。



- (8) インチング押ボタンスイッチを押してワイヤを送る。
- (9) ワイヤがチップ先端より1~2cm出たところでインチング押ボタンスイッチを放す。

#### 注記

- ・適用ワイヤ径以外のワイヤのご使用の場合は、そのワイヤ径専用のフィードローラ、SUSチューブ（オプション部品）に交換してください。

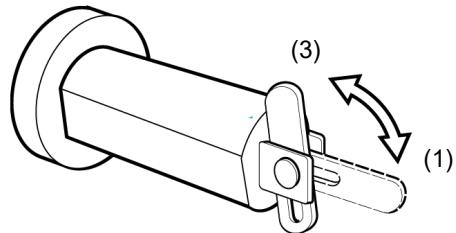

ワイヤ加圧調整

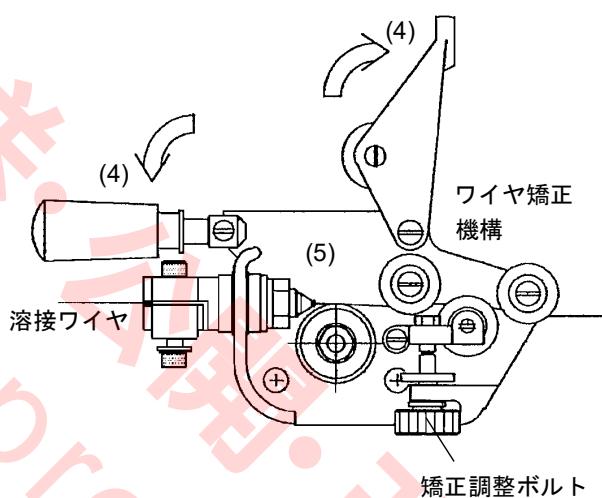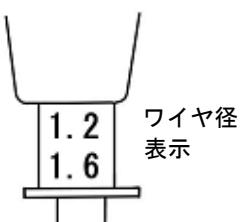

## 4. 保守・点検



### 注意

必ず配電ボックスおよび溶接機の電源を切ってから保守・点検をしてください。

部 位	点検のポイント	備考
SUS チューブ	<ul style="list-style-type: none"> <li>SUSチューブ入口やフィードローラ周辺に切粉やゴミがたまっていないか</li> <li>溶接用ワイヤの径とSUSチューブの呼び径の一致または適合性</li> <li>SUSチューブ受け口のセンターとフィードローラV溝のセンターがずれていないかチェック（目視にて）</li> </ul>	<p>切粉やゴミの掃除と発生原因のチェックとその除去</p> <p>不適切な場合には、アーク不安定や切粉発生の原因となる</p> <p>ずれないと、ワイヤの切粉発生やアーク不安定の原因となる</p>
フィード ローラ	<ul style="list-style-type: none"> <li>溶接用ワイヤの径とフィードローラの呼び径の一致または適合性</li> <li>フィードローラ溝のつまり、カケ、ミズのへたりなどをチェック</li> </ul>	<p>ワイヤの切粉発生の原因となり、ライナのつまりやアーク不安定の原因となる</p> <ul style="list-style-type: none"> <li>異常があれば新品と交換</li> </ul>
ガス バルブ	<p>溶接中、「ガスが出ない」「ガスが出放しになる」場合はガスバルブの異物詰まりが考えられますので、清掃が必要</p>	<p>送給装置ガスホースの入口、および溶接トーチの接続を外してください。 コントローラの「ガス点検スイッチ」をON-OFF（ガスバルブON-OFF）繰り返しながらガス出口側より乾いた圧縮空気でエアーブローしてください。ガス金具（ガス入口側）からのエアーブローは効果がありません。</p> <p>以上の作業でガスバルブが正常にならない場合、他の異常も考えられますので最寄りの販売店、サービス店までご連絡願います。</p>

### ◆ リモコン内のヒューズについて

リモコンケース内に1Aヒューズが装備されています。溶接トーチの劣化により、トーチ内のパワーケーブルとトーチスイッチ線が接触するとヒューズが溶断します。以下の現象が発生した場合、ヒューズの溶断が考えられます。原因を取り除き、指定の1Aヒューズに交換してください。

- トーチスイッチをONしても溶接できない。
- トーチスイッチをONしていないのに出力電圧が発生する。（電圧計が動く）

## ◆ Introduction

These are compact and light weight wire feeders for Panasonic welding power sources. This manual is applied for Panasonic wire feeders which modify applicable wire size from YW-60KC2.

## ◆ About safety

Please read all operating instructions of the applied welding equipment prior to start installation and operation.

## ◆ Warning symbols for safe usage

Each symbol describes things to be observed to prevent you and other personnel from hazardous conditions or damage to property..

● Each symbol below describes things to be observed to prevent you and other personnel from hazardous conditions or damage to property.		● The following symbols indicates things to be observed.	
 <b>Danger</b>	A hazardous situations including death or serious personal injury is imminent.		Things that MUST NOT be performed.
 <b>Warning</b>	The potential for a hazardous accident including death or serious personal injury is high.		Things that MUST be performed.
 <b>Caution</b>	The potential for hazardous accident including light personal injury and/or the potential for property damage are high.	 	Things attention must be paid to.

- The description of this manual is based on the contents as of **January, 2022**.
- The contents of this manual are subject to change without further notice.

# 1. Safety precautions



## WARNINGS

Observe the following instructions to prevent the hazard.

- (1) Never use the welding power source for other than welding purpose. (e.g. Never attempt to use the welding power source for pipe thawing.)
- (2) It is very important to comply with all instructions, safety warnings, cautions and notes mentioned. Failure to do so can result in serious injury or even death.
- (3) Work of driving source at the input side, selecting work site, handling, storage and piping of high pressure gas, storage of welded products and also disposal of waste should be performed according to the operating instruction and national, state and local codes and regulations.
- (4) Prevent any unauthorized personnel to enter in and around the welding work area.
- (5) Pacemaker wearers should consult their doctor before going near arc welding. Magnetic fields can affect pacemakers.
- (6) Only educated and/or skilled persons who well understand this welding power source should install, operate, maintain and repair the unit.
- (7) Only educated and/or skilled persons who well understand the operating instruction of the unit and are capable of safe handling should perform operation of the unit.

### Ventilation and protective equipment



Oxygen deficit, fume and gas generated during welding can be hazardous.

- (1) When conducting welding in the bottom of the tank, boiler or hold as well as legally-defined sites, use a local exhaust specified by the applicable laws and regulations (occupational safety and health regulation, rules on preventing suffocation or etc.) or wear protective breathing gear.
- (2) To prevent dust injury or poisoning by the fume generated during welding, use a local exhaust specified by the applicable law (occupational safety and health regulation,

rules on preventing injury by inhaled dust or etc.), or wear protective breathing gear.

If a protective breathing gear is used, it is recommended to use one with an electric fan with high protection performance.

- (3) When conducting welding in a confined area, make sure to provide sufficient ventilation or wear protective breathing gear and have a trained supervisor observe the workers.
- (4) Do not conduct welding at a site where degreasing, cleaning or spraying is performed. Conducting welding near the area where any of these types of work is performed can generate toxic gases.
- (5) When welding a coated steel plate, provide sufficient ventilation or wear protective breathing gear. (Welding of coated steel plates generates toxic fume and gas.)

### Against fire, explosion or blowout



Observe the following cautions to prevent fires explosion or blowout.

- (1) Remove any combustible materials at and near the work site to prevent them from being exposed to the spatter. If they cannot be relocated, cover them with a fireproofing cover.
- (2) Do not conduct welding near combustible gases.
- (3) Do not bring the hot base metal near combustible materials immediately after welding.
- (4) When welding a ceiling, floor or wall, remove all flammables including ones located in hidden places.
- (5) Properly connect cables and insulate connected parts. Improper cable connections or touching of cables to any electric current passage of the base metal, such as steel beam, can cause fire.
- (6) Connect the base metal cable at a section closest to the welding part.
- (7) Do not weld a sealed tank or a pipe that contains a gas.
- (8) Keep a fire extinguisher near the welding site for an emergency.



## CAUTIONS

### Installing shielding (curtain etc.)



Arc flash, flying spatter, slugs, and noise generated during welding can damage your eyes, skin and hearing.

- (1) When welding or monitoring welding, wear safety glasses with sufficient light blocking performance or use a protective mask designed for welding operation.
- (2) When welding or monitoring welding wear protective clothes designed for welding operation, such as leather gloves, leg cover and leather apron, and also wear long-sleeve shirts.
- (3) Install a protective curtain around the welding manipulator site to prevent the arc flash from entering the eyes of people in the surrounding area.
- (4) Be sure to wear noise-proof protective equipment if the noise level is high.

### Rotating parts



Rotating parts can cause injury.

- (1) Keep away from rotating parts such as cooling fans, feed roller of the wire feeder, or hand, finger(s) hair or part of your clothes may be caught by the parts resulting in injury.
- (2) Keep all covers, panels and cases closed when using the product.
- (3) Maintenance work and repair should be perform only by educated and/or skilled persons who thoroughly understand welding machines. While performing maintenance or repair work, provide fence or the like around the welding machine so that unauthorized person can not come close carelessly.

## 2. Connection




### CAUTION

Turn off all input power before connecting operation.

### 2.1 Connecting Power source and Gas regulator


Connect the wire feeder control cable and the power cable to the "Wire feeder" receptacle and the "+" output terminal behind the lower front panel respectively. The gas hose goes to the outlet metal of gas regulator.

No.	Description	Cables and hoses
1	Wire feeder control cable	Plug and receptacle connection
2	Power cable	Bolt and nut connection
3	Gas hose	Insert and fix with a band

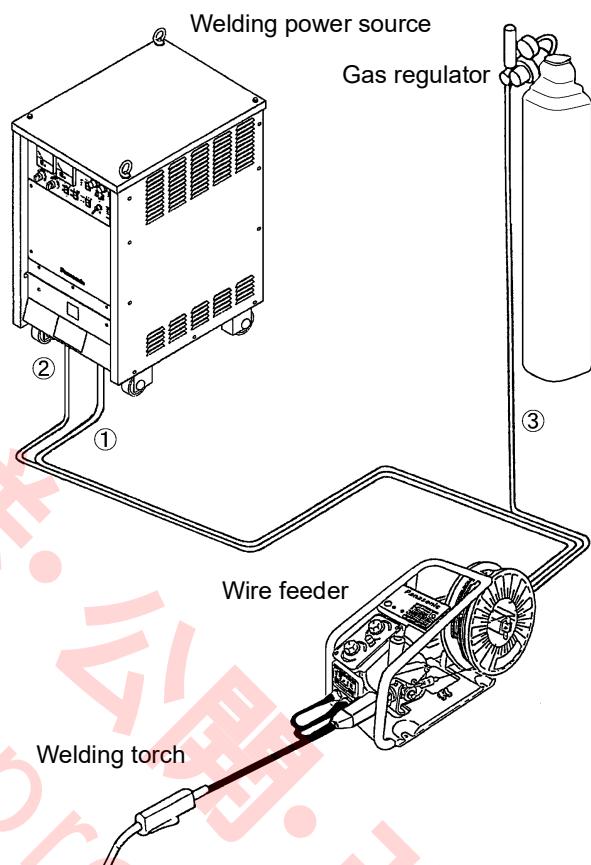

### 2.2 Connecting Welding torch

- (1) Meet the flat portion of connecting metal of the welding torch to the Fastening bolt side of the CC fitting metal and insert the connection metal into the CC fitting metal.
- (2) After complete insertion, turn the connecting metal 90 degree and fasten it up with the fastening bolt of the CC fitting metal.
- (3) The torch switch is connected to the torch switch receptacle and the gas hose is connected to the outlet metal of the gas regulator.

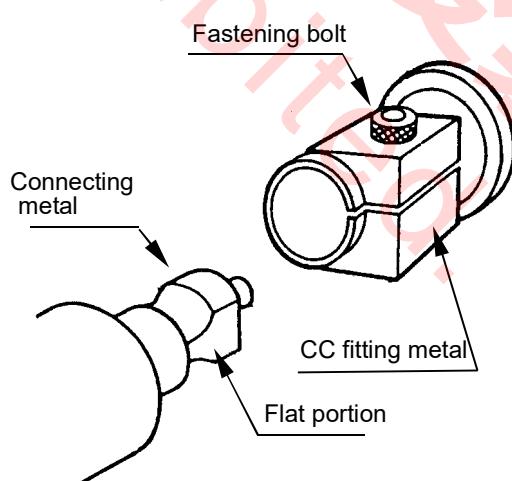

### 3. Preparation



#### CAUTION

- Rotating parts can cause injury.
- Keep your hands, fingers, hair or clothes away from rotating parts such as cooling fans, feed roller of the wire feeder, or hand, finger(s) hair or part of your clothes may be caught by the parts resulting in injury.



#### 3.1 Work environment

Install the unit in environment shown below.

- Indoor use only. (IP21)
- Range of the temperature of the ambient air:
- During welding : -10 to +40 deg C.
- Ambient air, free from abnormal amount of dust, acids, corrosive gases or substances etc, other than those generated by the welding process.

#### Note

- When lifting use of the unit, prepare a guide plate shown below. On safety, consult your plant engineers and safety management.
- When hanging the wire feeder, be sure to recompose SPOOL SHAFT to be SPOOL STOPPER vertical shown in figure to prevent the wire spool from falling.

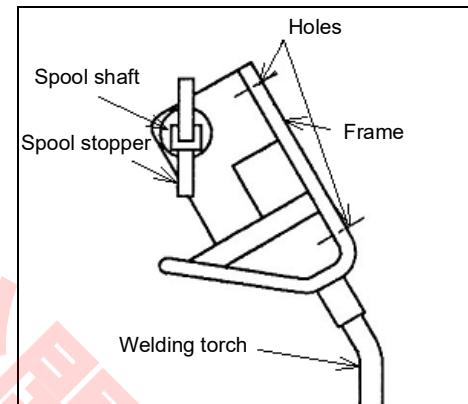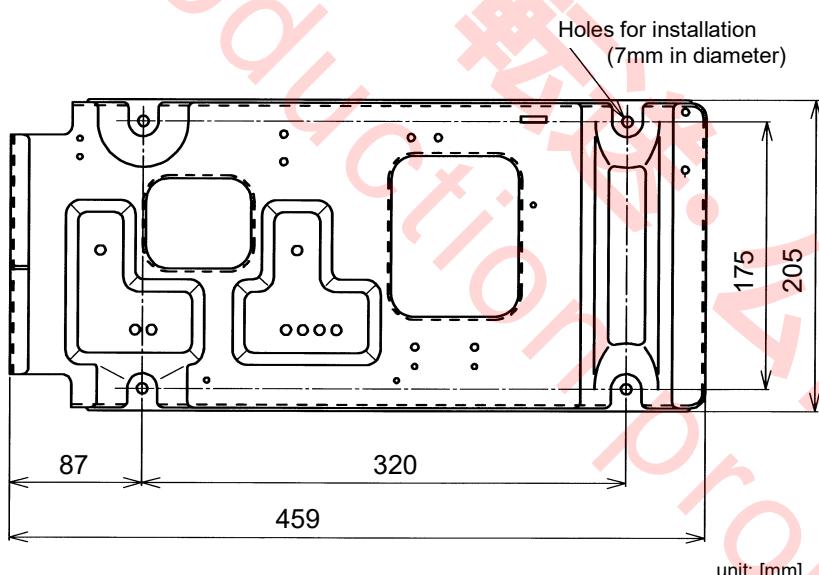

### 3. 2 Mounting Weld wire

- Feed roller installation

There are two grooves on the feed roller. Please confirm the size of the groove before installation. The indication stamp of wire diameter must be seen outside.

- Wire setting

- (1) Pull down the spool stopper.
- (2) Set the wire spool into the spool shaft.
- (3) Pull up the spool stopper and lock the wire spool.
- (4) Pull down the pressure nut and lift up the pressure arm.
- (5) The feeder has a wire straightener mechanism. Pass through the wire between the correcting rollers and Insert it about 3 cm into the SUS tube.
- (6) Adjust wire straightening pressure with the Adjusting bolt.
- (7) Return the pressure arm and lock it with the pressure nut. Adjust the wire pressure by turning the pressure nut.


**Note**

The position that bottom of the pressure nut meets wire size is appropriate wire pressure.


- (8) Push the inching button to feed the wire.
- (9) Release the inching button when the wire comes out about 2 cm from the tip end of torch.

**Note**


- In case of using the other size diameter of wire, exchange the feed roller and the stainless tube for applicable those. (Optional parts)

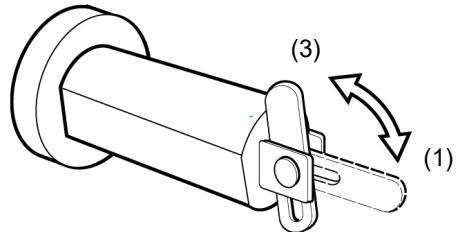



Wire pressure adjustment

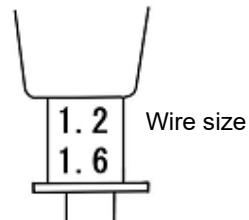

Wire size

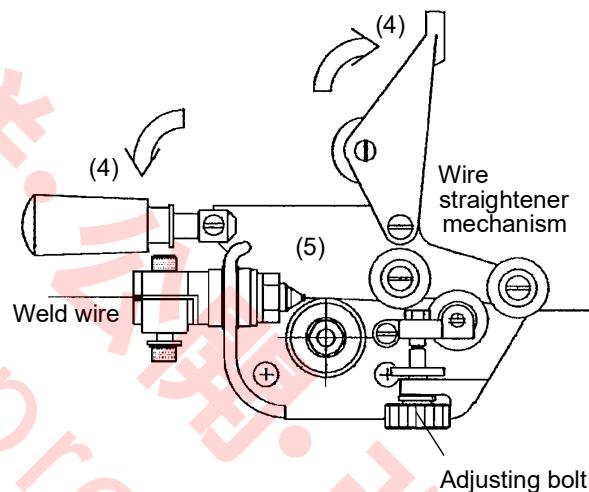

## 4. Maintenance

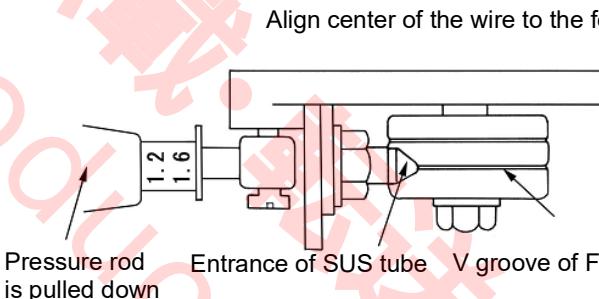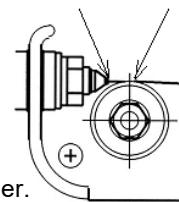 <b>CAUTION</b>		Turn off all input power before maintenance work
Item	Point of Inspection	Note
	<ul style="list-style-type: none"> <li>Are entrance of the SUS Tube and nearby the Feed roller clean?</li> </ul>	Remove dust and clean this parts once a week.
	<ul style="list-style-type: none"> <li>Is the wire diameter matched with the SUS tube?</li> </ul>	Unsuitable diameter cause unstable arc and dust increase.
	<ul style="list-style-type: none"> <li>Is center of SUS tube entrance aligned with center of the feed roller's groove?</li> </ul>	Unless these meet justly, unstable arc and dust increase.
SUS Tube	Align center of the wire to the feed roller groove. 	SUS tube    V groove of Feed roller. 
Feed roller	<ul style="list-style-type: none"> <li>Is wire diameter matched with the feed roller?</li> <li>Does the feed roller have right shape groove?</li> </ul>	Cause dust increase and choked liner and unstable arc. <ul style="list-style-type: none"> <li>If worn or cracked, replace it to new one.</li> </ul>
Gas Valve	<p>If either the gas does not come or does not stop during welding, one of the possible reasons in the gas path is that the gas valve in the wire feeder has become clogged by foreign matters. Carry out inspection and cleaning as described below.</p>	<ol style="list-style-type: none"> <li>As shown in the figure, remove the connections of the wire feeder gas hose at the inlet and exhaust sides.</li> <li>Blow off dirt and using a dry compressed air blower from the side A while repeatedly switching ON and OFF the "Gas Test Switch" in the welding power supply (thereby making the gas valve ON and OFF). (Blowing the air from side B has no effect.)</li> <li>If the gas valve operation does not become normal after the above operation, the problem may be due to some other cause and hence contact your service center closest to you.</li> </ol>

### ◆ Fuse in the remote controller

The remote controller has a 1A fuse. When the torch switch wire is electrically shortened with the power cable in the torch, the fuse may be blown off. Blowing the fuse shows following troubles. Remove cause of the trouble and replace the fuse with new one.

- No welding with the torch switch ON.
- Output voltage is generated without the torch switch operation. (The volt meter is moved.)

## ◆ 技術データ / Technical data

## 5. 共通技術データ /Common technical data

## 5.1 仕様 / Specifications

品番	Model number	YW-60KC2K series
適用溶接電源	Applicable power source	YD-600KH1
定格溶接電流	Rated welding current	600 A
適応ワイヤの種類	Applicable wire	ソリッドワイヤおよび FCW/ Solid wire and FCW
適応ワイヤ径	Applicable wire size	特殊仕様技術データ参照 See the customized technicl data
適応ワイヤスプール径 Applicable wire spool	軸径 /Shaft diameter	50 mm
	外径 /Outer diameter	Max 300 mm
	幅 /Width	Max 105 mm
ケーブル長さ	Cable length	1.8 m (ガスホース /Gas hose: 4.8 m)
質量	Weight	11.0 kg

## 注記

- 本機は必ず指定の溶接電源と組み合わせて使用してください。指定以外の溶接電源と組み合わせても使用できません。また機器の損傷を招く恐れがあります。


## Note

- Always use this nit with above applicable welding power sources. Other power sources do not work properly, or may cause machine troubles.

## 5.2 付属品 Accessories


部品名称	Description	数量 / Q'ty
六角レンチ	Hexagon wrench	1
ホースバンド	Hose band	1

## 5.3 外形図 / Dimensions

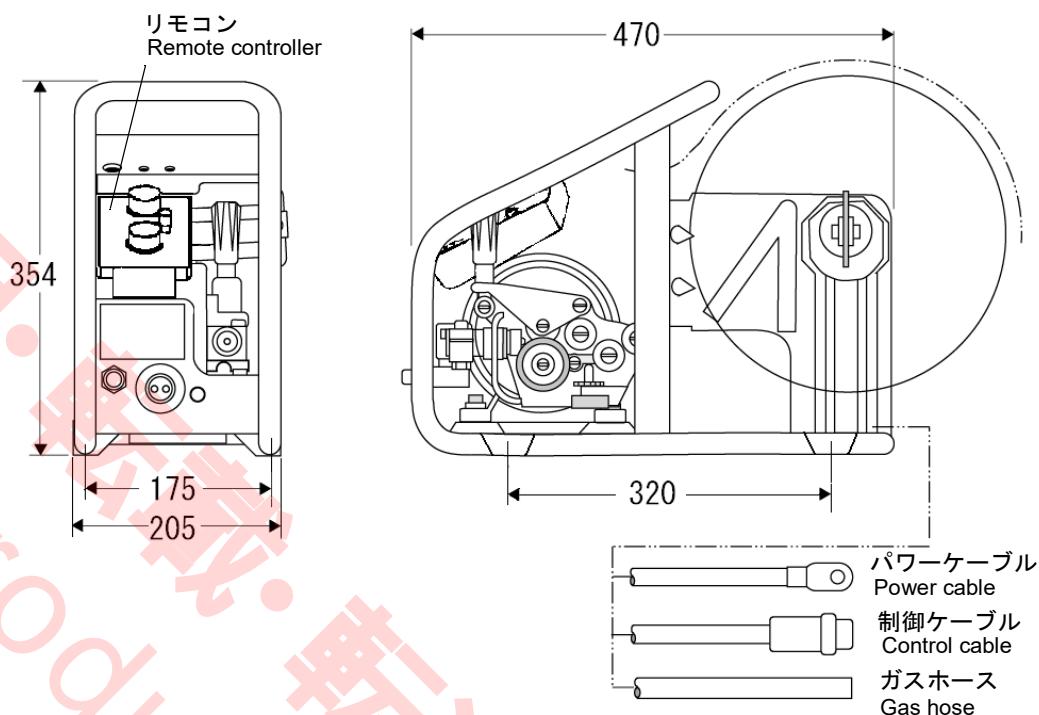


## 5.4 回路図 / Circuit diagram

5.5 パーツリスト / Parts list

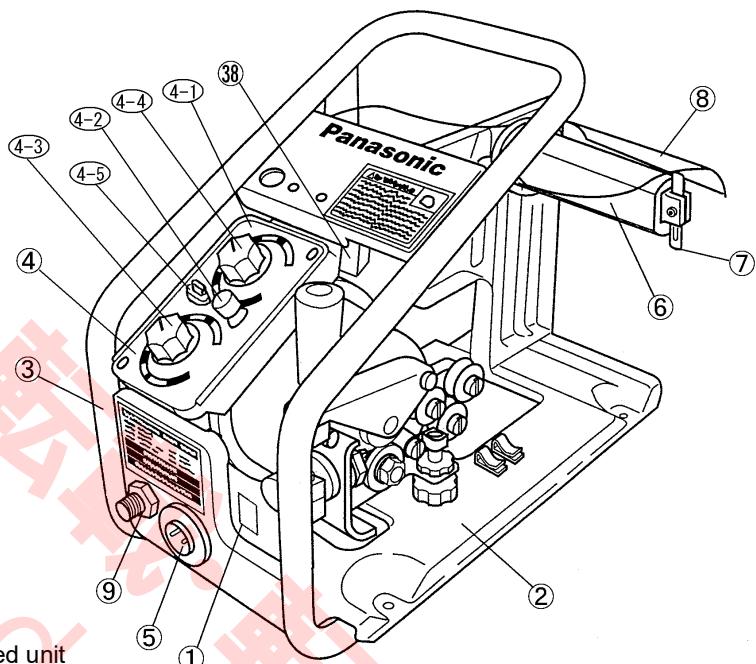

ワイヤ駆動部/ Wire feed unit

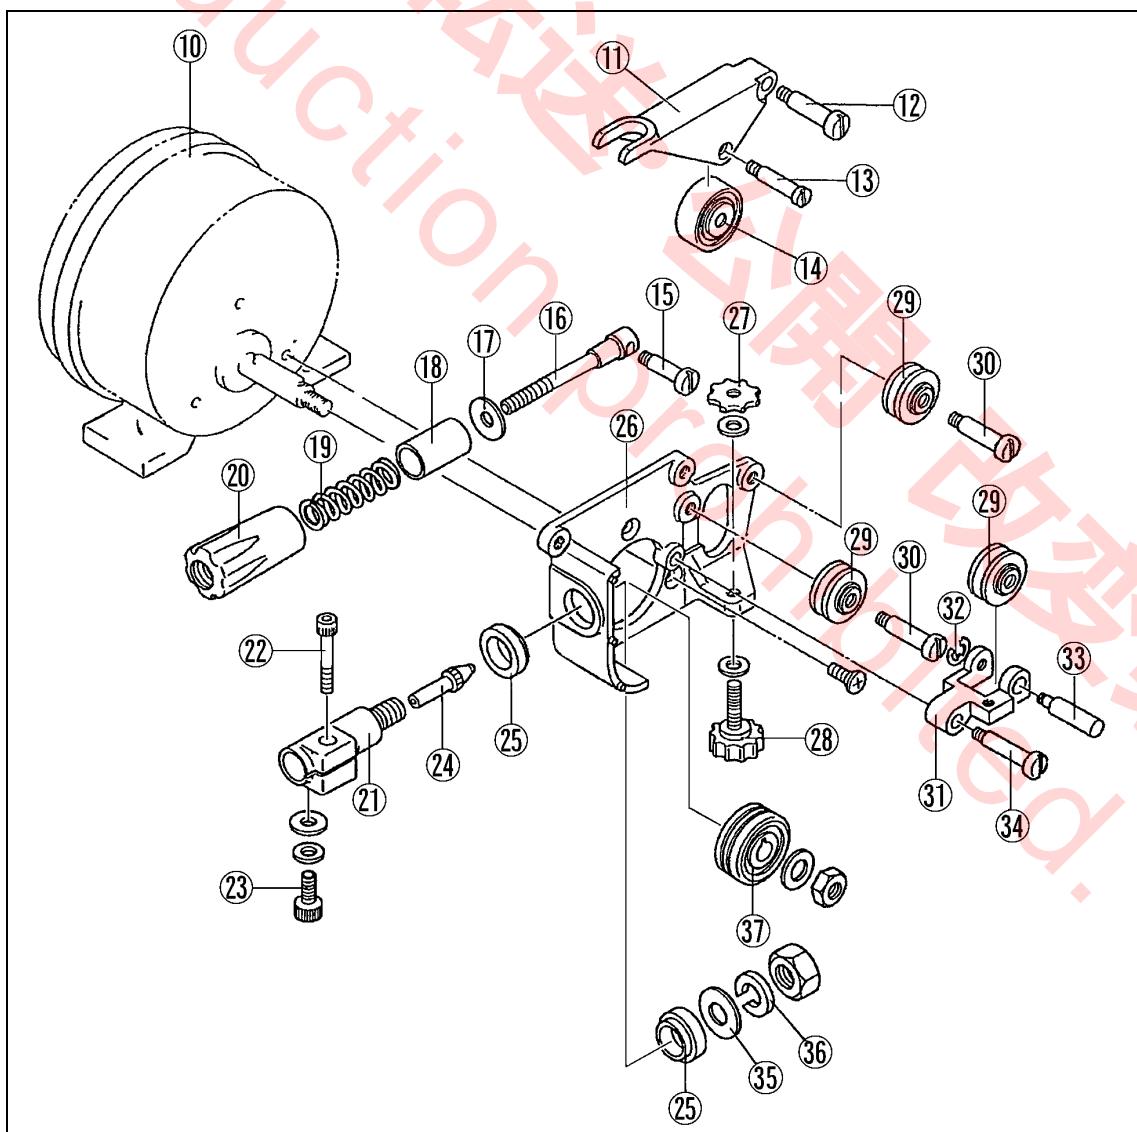

No.	名 称	Description	部品品番 Part number	数量 Quantity
1	コンデンサ組立品	Capacitor assembly	MEX00002	1
2	枠本体	Frame	MKH00139	1
3	ガスバルブ	Gas valve	MWX00056	1
4	リモコン	Remote controller	-	1
4-1	リモコン目盛板 (YW-60KC2)	Scale plate (YW-60KC2)	MKH00087	(1)
4-2	インチングスイッチ	Inching switch	MSU50106	(1)
4-3	可変抵抗 (VRa)	Variable resistor (VRa)	RV24YN20SA53	(1)
4-4	可変抵抗 (VRv)	Variable resistor (VRv)	RV24YN20SB53	(1)
4-5	ロータリースイッチ	Rotary switch	MTNS000932AA	(1)
5	トーチスイッチコンセント	Torch switch receptacle	MT25B2YP	1
6	スプール軸	Spool shaft	MDS00006	1
7	抜け止め座	Spool stopper	MMW00002	1
8	ワイヤカバー	Wire cover	MDK00011	1
9	ガス金具用ナット	Nut	DMN9/602	1
10	ワイヤ送給モーター	Wire feed motor	Y706-14K	1
11	加圧アーム	Pressure arm	MDA50122	1
12	ピン (1)	Pin (1)	MMP00005	1
13	ピン (2)	Pin (2)	MMP01024	1
14	加圧ローラ (組)	Pressure roller assembly	MDR35101	1
15	ピン (1)	Pin (1)	MMP00005	1
16	加圧ロッド	Pressure rod	MDS01019	1
17	ワッシャ	Washer	XWF10	1
18	加圧調整筒 (組)	Pressure control tube	MNX00007	1
19	加圧バネ	Pressure spring	MBP01403	1
20	加圧ナット	Pressure nut	MMN00002	1
21	C C 取付金具	Conduit cable fitting	MFC50107	1
22	六角穴付ボルト	Cap bolt	XVE8C28FP	1
23	六角ボルト	Bolt	XVG8C12	1
24	SUS チューブ	Stainless tube	***	***
25	C C 金具絶縁座	Insulating washer	MZK01403	2
26	U F ベース	Feed unit base	MDB50105	1
27	ロックナット	Lock nut	MMN00803	1
28	矯正調整ボルト	Adjusting bolt	MHT03202	1
29	矯正ローラ	Correcting roller	MGR02005	3
30	ピン (1)	Pin (1)	MMP00005	2
31	矯正フォーク	Correcting fork	MDA50123	1
32	E 形止め輪	Retaining ring	XUC5FP	1
33	ピン (4)	Pin (4)	MMP00824	1
34	ピン (1)	Pin (1)	MMP00005	1
35	ワッシャ	Washer	XWF14	1
36	スプリングワッシャ	Spring washer	XWB14B	1
37	フィードローラ	Feed rolle	***	***
38	ブレーキユニット	Brake unit	MKU00142	1

**注 記**

部品品番「\*\*\*」は特殊仕様技術データを参照してください。

**Note**

Part number “\*\*\*” is shown in the customized technical data.

## 6. 特殊仕様技術データ /Customized technical data

### 6.1 YW-60KC2KFN

#### 6.1.1 特殊仕様内容 / Customized specifications

品番	Model number	YW-60KC2KFN
適応ワイヤ径	Applicable wire size	1.2 mm, 1.4 mm

#### 6.1.2 パーツリスト / Parts list

No.	名称	Description	部品品番 Part number	備考 Note
24	SUS チューブ	Stainless tube	MGT01608	
37	フィードローラ	Feed rolle	MDR01401	1.2 - 1.4

### 6.2 YW-60KC2KFR

#### 6.2.1 特殊仕様内容 / Customized specifications

品番	Model number	YW-60KC2KFR
適応ワイヤ径	Applicable wire size	1.4 mm

#### 6.2.2 パーツリスト / Parts list

No.	名称	Description	部品品番 Part number	備考 Note
24	SUS チューブ	Stainless tube	MGT01608	
37	フィードローラ	Feed rolle	MDR01403	1.4 - 1.4

複用・転載・転送・公開・改変禁止  
Reproduction prohibited.

複用・転載・転送・公開・改変禁止  
Reproduction prohibited.

本用・販賣・轉送・公開・改竄禁止  
Reproduction prohibited.

転用・転載・転送・公開・改変禁止  
Reproduction prohibited.

---

パナソニック コネクト株式会社  
〒561-0854 大阪府豊中市稻津町3丁目1番1号

Panasonic Connect Co., Ltd.  
1-1, 3-chome, Inazu-cho, Toyonaka, Osaka 561-0854, Japan

© Panasonic Connect Co., Ltd. 2009

Printed in Japan

---

OMWT0304JE05